
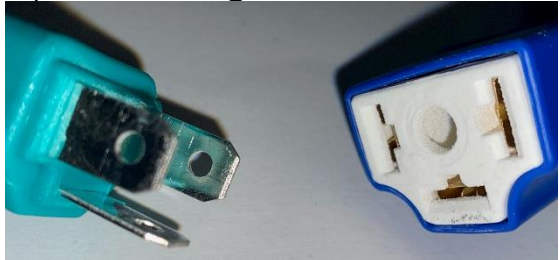







THE INSTALLER'S CHOICE

## 7" Headlight - Tech Tip

Issue: A time period after the installation, the headlights will not come on or start to flicker. This is not usually a defective product, and can typically be corrected by the following steps.

1. Remove the headlight ( <a href="#">instruction</a> )	2. Locate the H13 to H4 connector.
3. Disconnect the H4 connectors. 	4. Using Quick Dry electronics parts cleaner ( <a href="#">IB05101</a> ) clean both the adapter terminals, and those of the replacement light. 
5. Using a quality electrical grease ( <a href="#">IB05113</a> ) into the H4 socket.	6. Disconnect the H13 connector from the vehicle side, inspect the vehicles connection.
7. If damaged replace with proper OEM replacement. [Mopar P/N 68018959AA]  	8. If no damage, clean with Quick Dry cleaner, and electrical grease. 
9. Reconnect the harnesses and secure your Heise lights into the headlight bucket. Test all functions of the lighting system.	10. Complete service by reinstalling the headlight trim rings, and grille.
11. Verify installation with vehicle fully assembled, test functionality again.	12. . If you are still having issues, please contact Tech Support via email at <a href="mailto:techsupport@metra-autosound.com">techsupport@metra-autosound.com</a>



www.MetraOnline.com

Tech Support  
(386)257-1187